



SIB 61 01 20

ACCESSORIES DO NOT POWER ON

2020-10-21

This Service Information Bulletin (Revision 2) replaces SI B61 01 20 **dated August 2020**.

What's New (Specific text highlighted):

- All sections except Procedure

MODEL

E-Series	Model Description
F95	X5 M SAV (Sports Activity Vehicle)
F96	X6 M SAC (Sports Activity Coupe)
G05	X5 SAV
G06	X6 SAC
G07	X7 SAV
G20	3 Series Sedan
G29	Z4 Roadster

Note: Not applicable to vehicles with the heated cup holder option code SA 44A.

SITUATION

Customer is unable to power up or charge accessories through a plug adapter inserted in the front 12-volt power socket plug. Alternatively, it will only operate when constant downward hand pressure is maintained.

CAUSE


A design change was intended to reduce short circuits and blown fuses. When the plug adapter is inserted, the center contact pin may not make proper contact with the center pin of the power socket plug.

CORRECTION

Only those customers that experiences this situation:

- Replace the assembly screw at the front 12 V power socket.

PROCEDURE

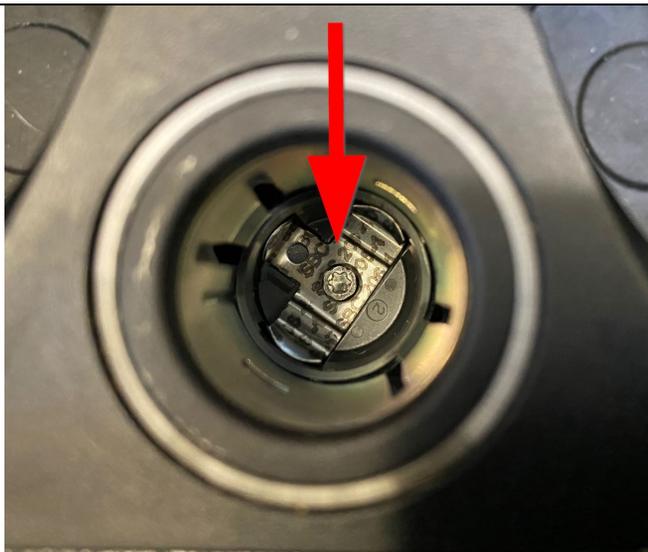


1. Remove the fuse that powers the front 12 V power socket. Fuse number and location can be found in ISTA or AIR.

2. Loosen the Torx screw using a T10 bit driver. **DO NOT apply too much downward**



pressure as this can cause the power socket to come apart underneath.

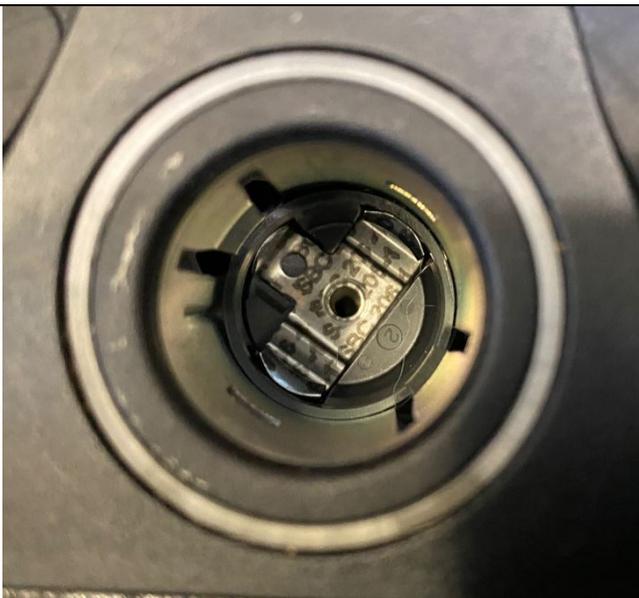

3. Remove the Torx screw.



4. Insert the replacement screw and hand tighten (McMaster-Carr, item number 91292A112).

5. Using Special Tool 0496778, torque the



screw to 1 (one) Nm.

6. Retest the customer's accessory.

PARTS INFORMATION

Replacement screw can be purchased from McMaster-Carr, (industrial supply).

Please see use link below.

<https://www.mcmaster.com/91292A112/>

Part Number	Description	Quantity
NPN	18-8 Stainless Steel Socket Head Screw McMaster-Carr Part 91292A112	1 in Sublet

WARRANTY INFORMATION

Covered, one time, under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code: <input type="text" value="85800307NA"/> <input type="text" value="B61 01 20 12 V socket outlet center pin retrofit repair"/>		
:		
Labor Operation	Description	Labor Allowance
61 99 000	Job/repair work time to retrofit the 12 V socket center contact screw (Main work)	3 FRU
Or:		
61 99 000	Job/repair work time to retrofit the 12 V socket center contact screw (Plus work)	2 FRU

As applicable to your center, please refer to **SI B01 01 20** or **B01 07 20** for claiming your diagnosis work time, job/repair work time (WT), WT and the repair-related explanation procedures.

And:

Sublet – Bulk Materials (RO and Claim Comments Required)

Sublet Code 4	Up to \$0.50	Reimbursement for the repair-related bulk material
----------------------	--------------	--

Sublet reimbursement calculation: Quantity one (screw) at cost plus 20 percent.

Enter this material cost in sublet and itemize the amount on the repair order and in claim comment section.

QUESTIONS REGARDING THIS BULLETIN

Technical Inquiries	Submit feedback at the top of this bulletin
Warranty Inquiries	Submit an IDS ticket to the Warranty Department or use the chat available in the Warranty Documentation Portal
Parts Inquiries	Submit an IDS ticket to the Parts Department